


1.Retainer SVC Bulletin for 50PQ Series


-Application Range

1. Model: **50PQ series** Application Module : PDP50G20001.####, PDP50G20324.#### Serial number range 901~906
2. Symptom: dark bottom half of picture, bottom half unclear picture, bottom half no display
3. SVC Guide
 - Remove the back cover
 - Insert 12pin retainer for Y Drive boards at connector pins
4. If service is for a different type symptom but S/N is in 901~906 range, 12pin retainers need to be inserted during service.

□PDP Module Picture

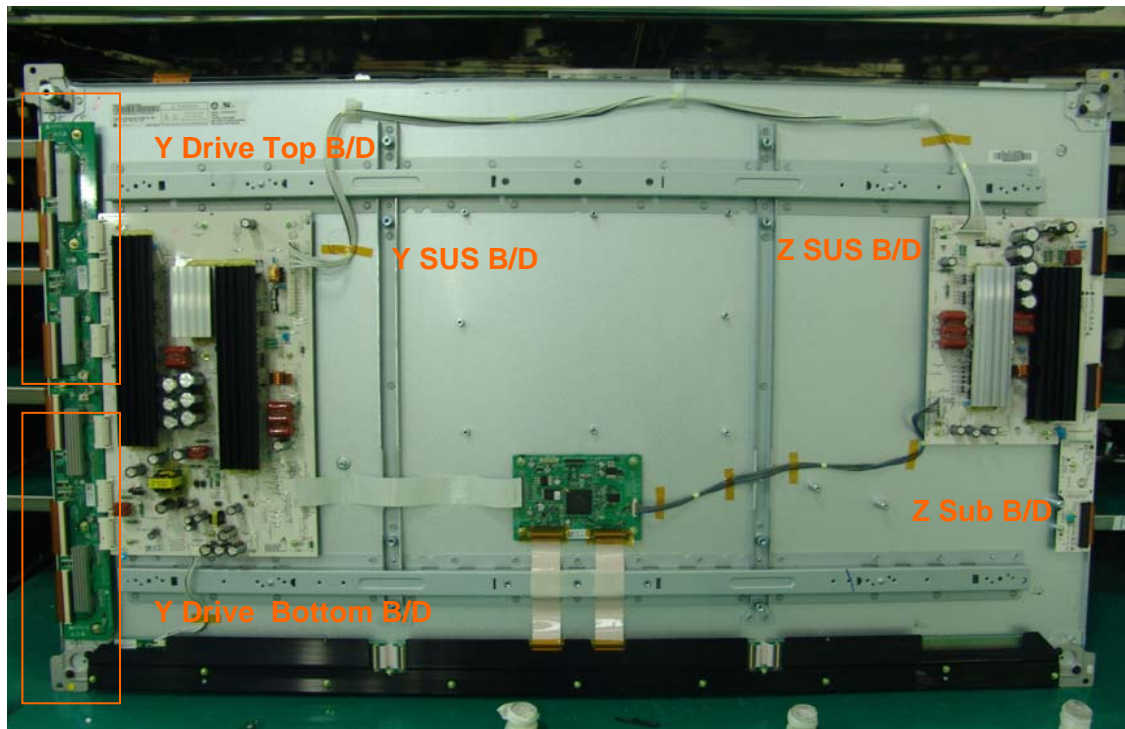


□Symptom

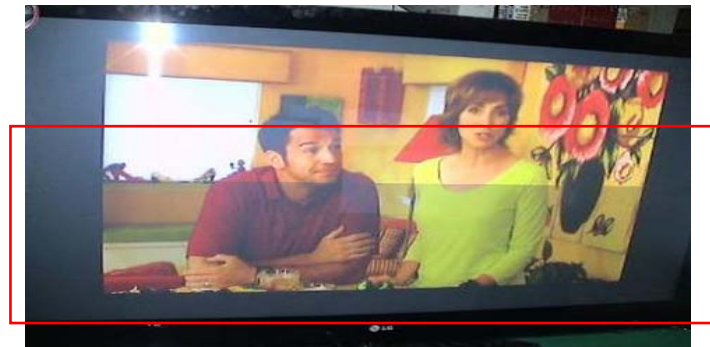

Please see the below SVC guide for Y Drive TOP & Bottom board


Before

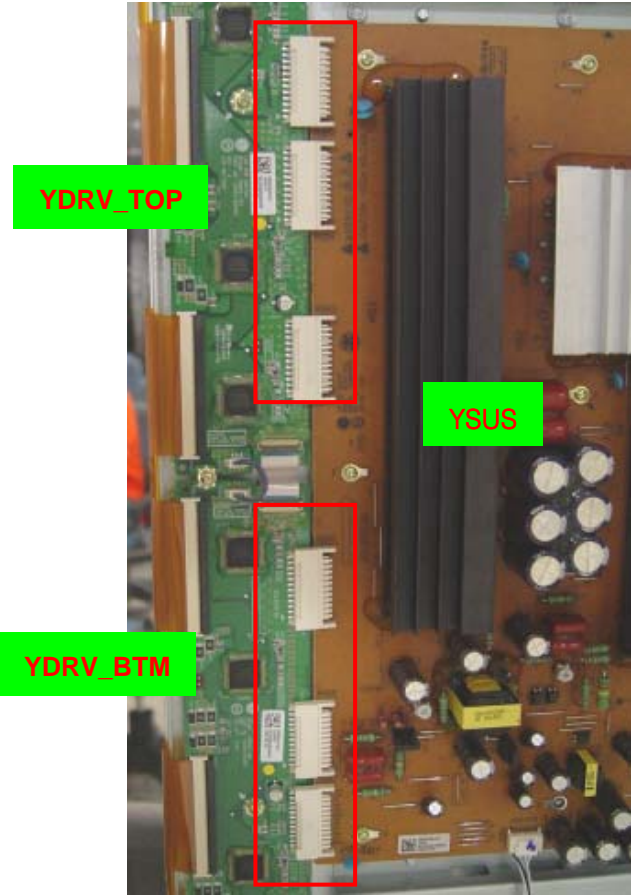

□12pin Retainer (P/N EAG61050702)
:Required retainer quantity is 6EA




After

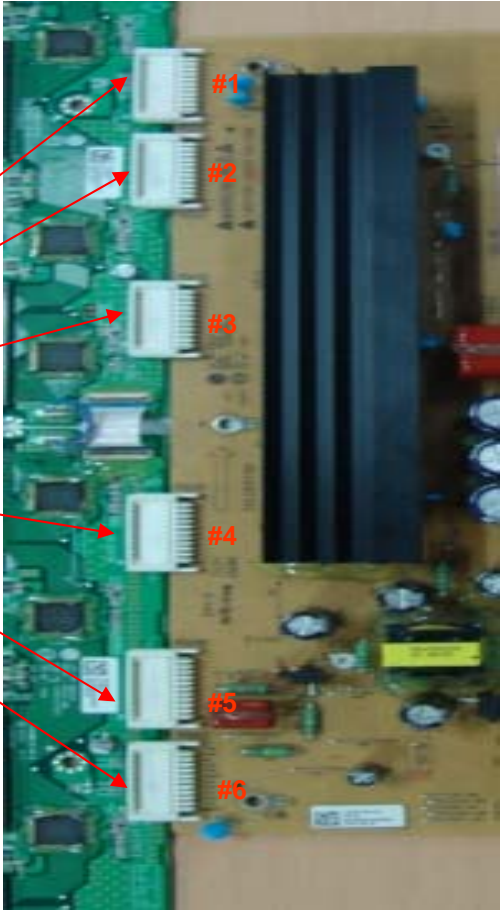

Push 12pin retainer into place until the latch clicks.

□YDRV_TOP

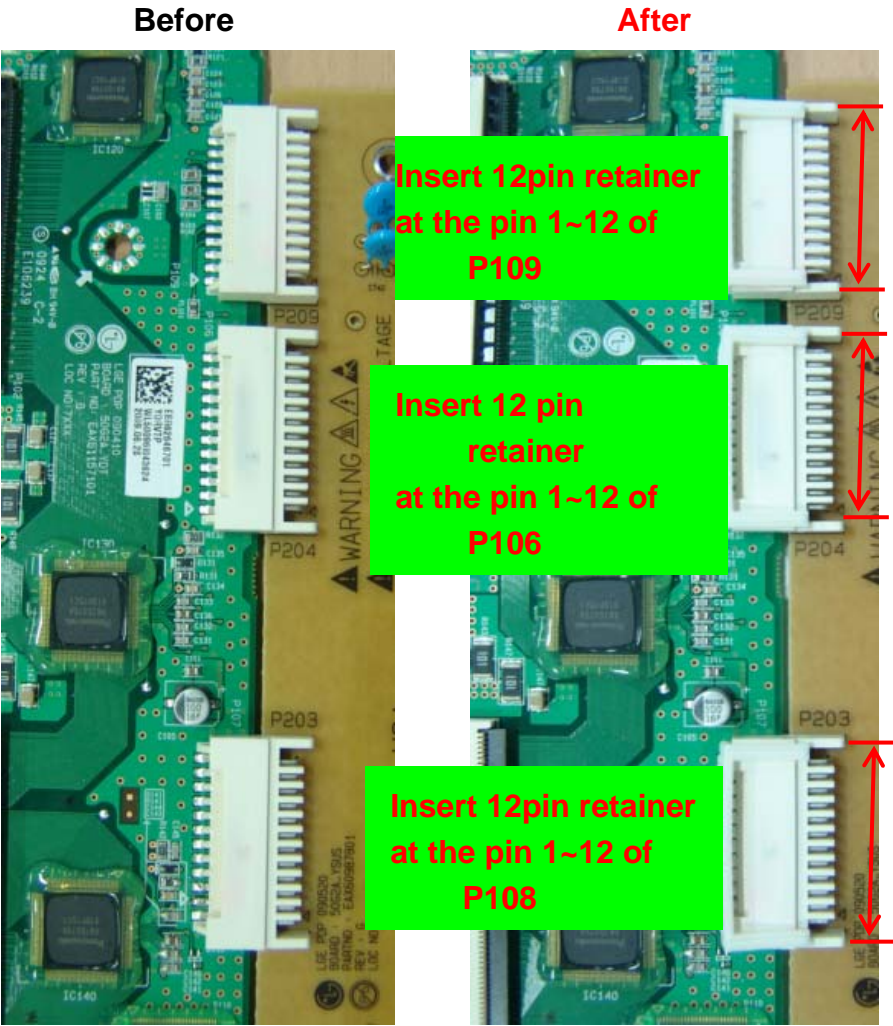

□YDRV_BTM

